

Applies to aircraft model Saab 91B och 91C, Safir, serial Nos. 91.201 - 91.289.

*Wing Flap Control.*

In some cases it has been revealed that the thickness of material of the journal pin 506578 on the torsion tube of the wing flap has been less than the minimum tolerance. For this reason all journal pins shall be checked as to material thickness, as shown in the figure below. If journal pins with a material thickness less than 1.2 mm is found the pin shall be replaced. This inspection shall be carried out in accordance with the manufacturer's Modification Bulletin No. 91 4/4, dated November 10, 1954.

