



service bulletin

Date: Dec. 1960

No. 91.1.002

AIRCRAFT SAAB SAFIR 91A, 91B, 91B-2, 91C AND 91D

SUBJECT: Checking and adjustment of lock pins for front seat buckets.

REASON: To facilitate checking and increase the safety of seat bucket locking.

TIME OF COMPLIANCE: At owner's discretion.

PARTS AFFECTED: Front seat LH and RH according to Spare Parts Catalog 91.1100/03 item 1 for 91A, and 91.1105/03 item 1 for 91B, 91B-2, 91C and 91D.

WORK PROCEDURE: Dismount the seat buckets.
Check that pin item 3 protrudes 15 mm (0,6") outside of bracket item 2. If shorter, adjust to minimum 15 mm by extending the slot for pull rod handle item 5 in the seat bucket spar, see figure 1.
Paint a line inside the seat bucket spar corresponding to the position of the pull rod handle when the pin is released, see figure 2. This line will simplify checking of correct seat bucket locking in the aircraft.

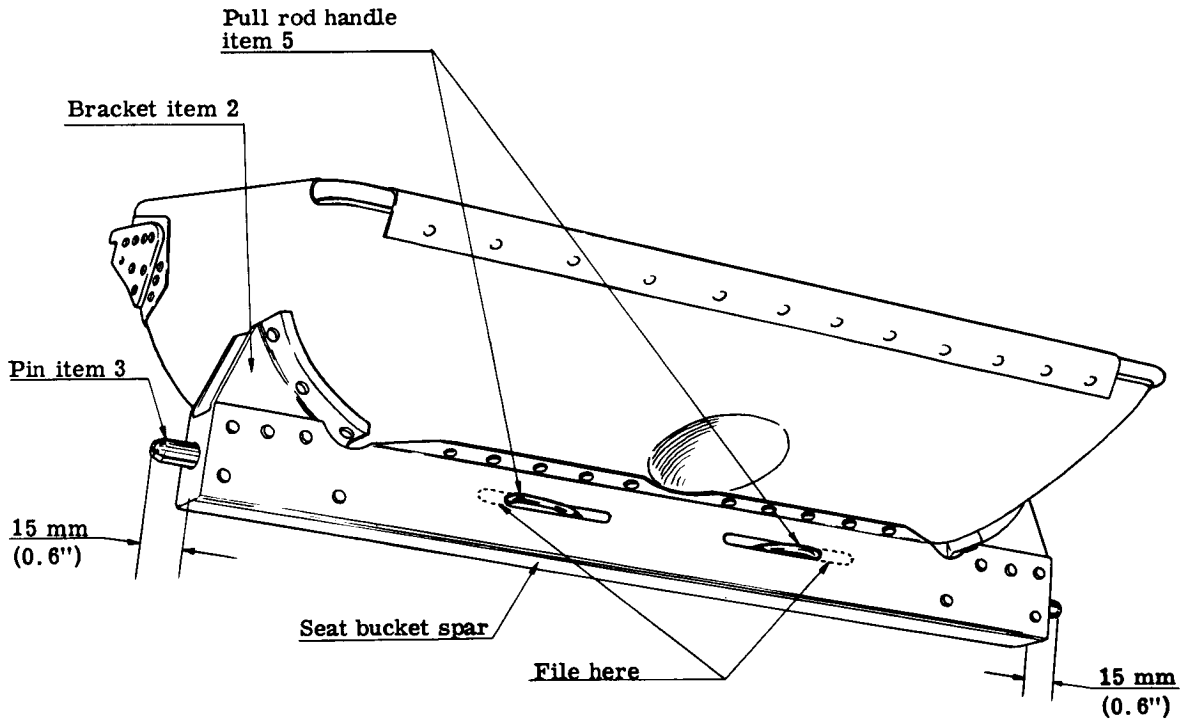


Figure 1.

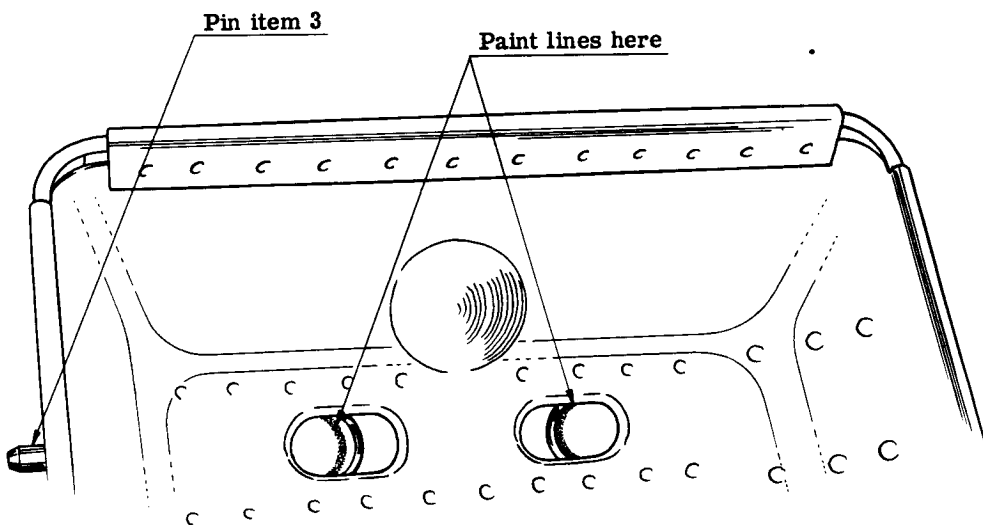


Figure 2.