

SERVICE BULLETIN

Date: Febr. 1986 No 91.4.003

Aircraft: SAAB SAFIR 91B, 91B-2, 91C and 91D

Subject: Inspection of fuel hand-pump actuating system.

Reason: It has been reported that the cable assy of the manually actuated fuel pump has failed during operation in an emergency situation.

Parts affected: Hand-pump actuating system. See attached parts list and figure.

Time of compliance: At all 100-hours inspections.

- Required action:
1. Check cable assy SA594653/SA594691 for proper attachment to handle and segment. Check cable for damage and wear at flanged coupling at handle and around pulley and housing at fire-wall.
 2. Check return spring, bracket and cable assy SA594654 for general condition and proper installation.
 3. Check segment, push-pull rod and pump actuating lever for damage, wear and proper installation.