

Date November 1957

No. 91.6.006

AIRCRAFT SAAB SAFIR 91B, 91B-2 AND 91C

SUBJECT: Magneto Bendix-Scintilla SF6LN-8

TIME OF COMPLIANCE: For information purposes.

PARTS AFFECTED: Ground terminal screw bushing ref. no. 88 and washer ref. no. 94 according to Service parts list Bendix-Scintilla magnetos SB6 and SF6 series, page 3F-483.

REASON: To prevent damage to the bushing which may cause short-circuit in the magneto.

Avoid excessive tightening of the ground terminal screw, item 1, see figure below, as this may damage the bushing, item 2.

Use washer p/n 10-5534, item 3, which has an outside diameter of 11,2 mm (7/16"). Washers with less outside diameter may shear off the flange of the bushing and washers with greater outside diameter may cause short-circuit directly to the shield, item 4.

