

Reference Airplane 91 Safir. Safety Equipment. Replacement of bolt assembly for lap strap front seats.	Date December 14, 1967	No. 91.9/3
	Saab Service Dept. C Larsson	
	Saab Design. Dept. S Lundgren	
Urgency IV	Royal Swedish Board of Civil Aviation S Fogelström	

Marking -	Effect on weight distribution		
	Weight change Lbs	Station In.	Moment change Lbsin.
	-	-	-

Time of delivery for necessary parts
4 months after order

C/C

Information:

The control stick can in its rearmost position and under unfavourable conditions contact the bolt safety spring and cause withdrawal of the bolt. For this reason a new bolt with bent-down spring end can be introduced.

<p><u>Drawings:</u> Not essential</p> <p><u>Parts required per plane:</u> 2 Bolt Assy SA 9101244 (1158769-1)</p> <p><u>Parts required per spare part:</u> 1 Bolt Assy SA 9101244 (1158769-1)</p> <p><u>The following parts are obsolete:</u> Bolt Assy SA 590554 Alt SA 9101116</p>	<p><u>Airplane involved:</u> 91101-91432, 91439</p> <p><u>Spare parts concerned:</u> Strap SA 594466 To be changed Strap SA 594915 To be changed Strap SA 9101055 To be changed Strap SA 590549 To be changed</p>
---	---

Work procedure:

Remove existing bolt and fit the new bolt SA 9101244.



BOLT ASSY SA 9101244 (1158769-1)