



MODIFICATION BULLETIN

AIRPL
MODEL
91B

91.6/8

PAGE 1 OF 1

Engine mounting. Moving of manufacturing plate

URGENCY: III At service inspection

EFFECT ON WEIGHT DISTRIBUTION:

TIME OF DELIVERY
FOR NECESSARY PARTS: -

WEIGHT CHANGE
LBS.

STATION
IN.

MOMENT CHANGE
LBSIN.

K/K

-

-

-

MARKING: -

Drawings: Not essential

Aircraft concerned:

Parts required per plane and spare part:

91201-91272

Item Ref figure:

Spare parts involved:

01 2 Screw AS 212105-2.8x6


Engine mounting 91.6312

Due to corrosion having occurred underneath the manufacturing plate for the engine mounting this plate should be moved to the bracket for the mixture control.

Work procedure:

Remove the manufacturing plate and clean the engine mounting free from corrosion and apply protective paint.

Secure the manufacturing plate to the bracket for the mixture control on the underside of the mounting in accordance with the figure below.

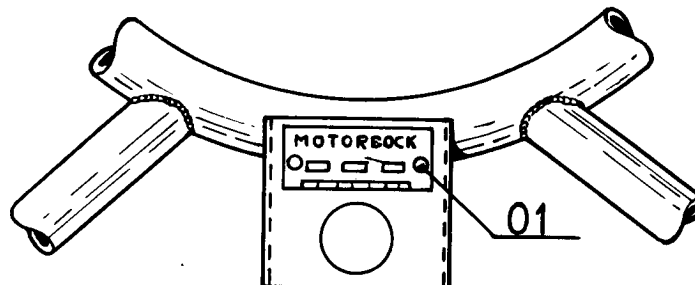

January 9, 1954

SAAB SERVICE DEPT:

SAAB DESIGN DEPT:

ROYAL SWEDISH AERONAUTICS BOARD:

L. Nilsson

A. Andersson

R. Fogelberg